

SIL 4500-11 Service Information Letter SN4500 Primary Navigation Display

Date: 20-September-2012

Regarding: SN4500 Primary Navigation Display, Software Release 2.05

SIL Revision: B – Availability of software version 2.05

A – Initial release (software version 2.04)

Reason

Supersedes revision A of this SIL due to the availability of software version 2.05

Applicability

Applies to Sandel part number SN4500-xxx and SN4500-xxxx

Description

New Features:

 Adds LNAV roll steering capability without external adapters or wiring changes. Uses GPS/FMS Label 121. With appropriate GPS/FMS will fly procedure turns and holding patterns. See Pilot's Guide revision F. NOTE: Requires key code for use – please contact Sales.

Improvements

- Improved external brightness control operation.
- Improved card stabilization from fluxgate from inverter failure when using ARINC 407 (XYZ) DG and internal slaving.
- Improved electrical resolution of ARINC 407 bootstrap compass output to improve operation in helicopters using this output for yaw damper. No effect on existing installations.
- Added support for multi-channel DME.
- Improved display of reversionary attitude when using external AHRS.
- Added installer option for display of heading bug in white.
- Added installer option to remove pilot selection of auto-slew off.
- Added installer option for DME source when using XYZ TACAN interface.
- Modified installer options for configuration module read/write operation.
- Improved fluxgate operation at high latitudes.
- Added installer option for recording of flight data.
- Added installer option for remote OBS input.
- Added installer option for alternate glide slope and localizer symbology.
- Added installer option for display of center vertical deviation indicator.

<u>SIL</u> 4500-11-B.doc Page 1 of 2



SIL 4500-11 related files including the software update, software load utility and instructions can be accessed on the Sandel website at:

http://www.sandel.com/SN4500_sup_sw_download.php [case-sensitive]

- or -

Contact Sandel Product Support at (760) 727-4900 selection '2'

Note: Immediately following a field software update, the unit must be powered back on in maintenance mode and an 'SN4500 to CM' operation be performed.

Compliance

Optional

Warranty Reimbursement

None

Manpower

1 hour

Approval

This modification does not affect the original approval. Contact Sandel for details if needed.

Identification

No change

Testing

None

Documentation

82009-IM Rev. I Installation Manual 82009-PG Rev. F Pilot's Guide

END

<u>SIL</u> 4500-11-B.doc Page 2 of 2