

## SB 4550-04 Service Bulletin

Date: August 20, 2009

Regarding: SA4550 with LED Backlight – display discoloration

Revision: A, Initial Release

#### Reason

Problems in the field with display discoloration.

## **Applicability**

Applies to all serial numbers SA4550-XXX without MOD 1. (All units shipped prior to August 24, 2009).

#### Description

There have been an increasing number of units returned to the factory for repair due to a discoloration (darkened area) in the center of the screen. This appears to occur on a random basis and some units are not affected. This problem has been traced to a combination of manufacturing tolerances and a plastic polarizer in the optical system which is not meeting its published specifications.

NOTE: This is a cosmetic condition, not a safety of flight condition.

A replacement glass polarizer has been designed which is not subject to this problem. This part can be factory retrofitted into any existing LED backlight unit.

#### Compliance

On condition. The factory will perform this modification at any time during the service life of the affected unit. We recommend this repair be performed at a convenient time during normal airframe maintenance so it will not affect dispatch.

To schedule the modification please contact Sandel and obtain an RMA number. Contact Sandel at 760-727-4900, select option '3' and then option '1' for RMA assistance. Or email <a href="mailto:sales@sandel.com">sales@sandel.com</a> with your contact information.

## **Warranty Reimbursement**

None.

SB 4550-04-A.doc Page 1 of 2



## **Documentation**

None.

# **Approval**

This modification does not affect the original approval.

## Identification

SA4550 units with the modification will be marked with MOD 1.

**END** 

SB 4550-04-A.doc Page 2 of 2